

MODEL FS-3

Volt-Amp-Ohm-Temperature Flat Scale Clamp-on

FEATURES

- Drop proof up to 5 feet.
- Ohmmeter fused to 250VAC.
- Check surface, air or liquid temperatures.
- Taut band meter movement.
- Average sensing, RMS calibrated.
- Pointer lock.

SPECIFICATIONS


Ranges: 0-6/15/40/100/300 Amps AC
0-150/300/600 Volts AC
Rx1 and Rx100 Ohms (25 midscale on Rx1)
-25°F to 225°F (-32°C to +107°C)

Frequency: 50/60 Hz

Accuracy: ±3% F.S. (Amps, Volts)
±3% of scale length (Ohms, Temperature)

Power: One S915 "AA" battery (not supplied)

Fuse: One 8AG-361.5, 0.5 Amp,
250 Volts Fast Blow (supplied)

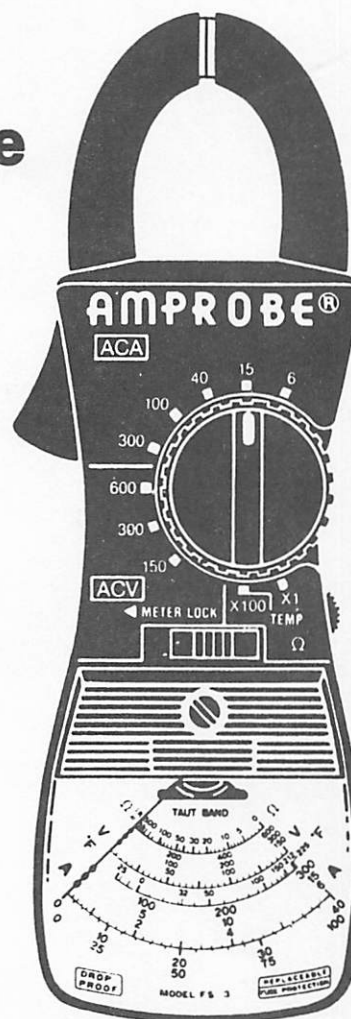

Model FS-3:

Fahrenheit scale instrument with leads.

Model FS-3C:

Centigrade scale instrument with leads.

Model FS-3L:

Fahrenheit scale instrument with leads and case.

Model FS-3CL:

Centigrade scale instrument with leads and case.

ACCESSORIES AND REPLACEMENTS

Description	Model
Fuse, .5 Amps, 250 Volts, Fast Blow...	8AG-361.5
Battery, AA (requires 1).....	S915
Immersion Temperature Probe.....	RBT-11P
Universal Temperature Probe.....	RBT-12P
Vented Air Temperature Probe.....	RBT-13P
Clip-type Test Leads.....	VL-11R
Carrying Case.....	L